



MODEL 5691 CEILING RADIATION / FIRE DAMPER ASSEMBLY


PRODUCT DESCRIPTION

CEILING RADIATION/FIRE DAMPERS as described are installed to protect the penetrations in the ceiling membrane portions of fire rated Floor / Ceiling or Roof / Ceiling assemblies, as a shield against fire and heat radiation.


The Model 5691 Ceiling Radiation / Fire Damper is test proven for 2 hours in a 120/120/120 Boral Fire Rated Ceiling system, and certified for 1 and 1.5 hour ceiling systems.

The damper capabilities **MUST** cover three important areas, Flame, Heat and Smoke:

- a) **STOP FLAMES** and combustile materials from entering the duct above, and spreading throughout the building
- b) **REDUCE RADIANT HEAT** which could ignite materials above the fire rated ceiling, and
- c) **REDUCE** the transfer of **SMOKE** and dangerous **HOT GASES** from the fire zone to the non-fire zone.

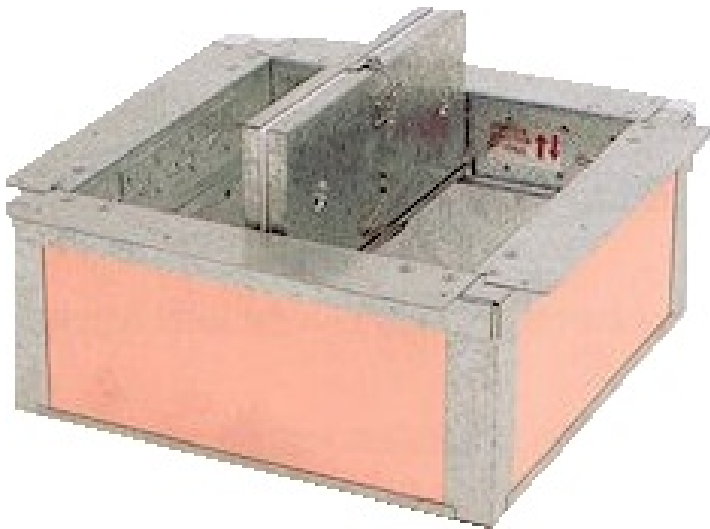

DAMPER ASSEMBLY

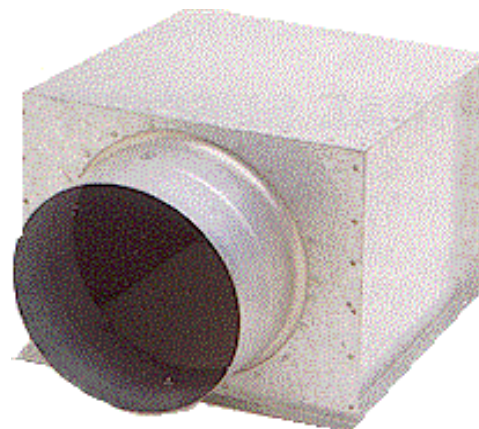

PLENUM / SPIGOT

Your local representatives details can be located at www.bullockmfg.com.au





BULLOCK

www.bullockmfg.com.au

MODEL 5691 CEILING RADIATION / FIRE DAMPER ASSEMBLY

FEATURES

- Australian Certified to AS1530.4-1997 by the C.S.I.R.O. - Test #FS3033/1516.
- Optional Airflow tested by the C.S.I.R.O. for blade closure in excess of 18m/s. Test #FS3099/1961.
- All galvanised steel construction.
- Structurally strong 'C' shaped centre pivot.
- Incorporates a high yield 2mm stainless steel spring(s).
- Single (UL33 rated) Fusible Link located for quick response to temperature rise.
- Heat resistant 13mm high density ceramic fibre board blade insulation.
- Readily available square and rectangular sizes from 1500mm x 150mm up to 600mm x 600mm

INSTALLATION

Compliance with installation instructions is critical. Refer to separate instructions for specific PLASTERBOARD fire rated ceiling system used.

MAINTENANCE - This mode damper requires little maintenance once installed. Refer to AS1851-2012 for detailed servicing procedures.

TYPICAL SPECIFICATIONS

Openings in Ceilings are required to have an FRL, shall be protected by a BULLOCK MODEL 5691 CEILING RADIATION/FIRE DAMPER or approved equivalent.

The dampers shall be provided where shown on drawings and wherever required to meet local regulations and **MUST** comply with AS1682.1-2015.

The damper construction must be in compliance with the tested prototype containing features as: High yield stainless steel spring(s), four corner blade locking for positive closure to achieve low air/smoke leakage. Dampers installed in return air or exhaust applications must be capable of operation, at airflow rates in excess of the actual design application. (NOTE: Model 591 dampers have a certified closure rating of 18m/s). Radiant heat effect from the face of the damper and leakage of hot gases must be reduced to maintain uninsulated metal duct surface temperature directly above the damper to below 150°C after 120 mins exposure. Blades must easily be reset from the underside for testing and maintenance in accordance with AS1851-2012.

Your local representatives details can be located at www.bullockmfg.com.au